



## Installing Palm Treo 650 LCD Screen



### ***Step 1 - repair Battery***

- Place your Palm Treo 650 on a table in front of you as shown.



### ***Step 2***

- Flip the phone over as shown.
- Remove the stylus found on the back of your phone.



### Step 3

- Remove battery cover.
- Hold down the button on the back near the middle of the phone.
- Slide the cover down.



### Step 4

- Lift the edge of the battery as pictured and pull out.






## Step 5 - Case

- Remove the small round rubber cover on the back of the phone.
- This will uncover a screw that will be removed in an upcoming step.



## Step 6

- Unscrew six 6.9 mm black screws with a T5 Star screwdriver.
- Unscrew one 9.75 mm antenna screw with a T5 Star screwdriver.
- Pull out antenna.

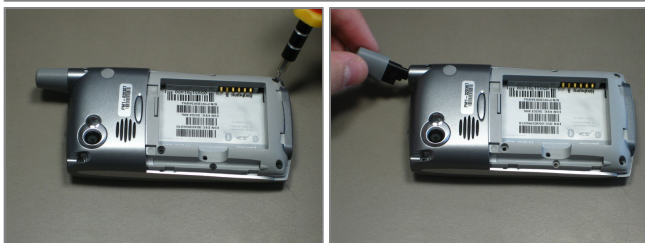






### Step 7

- Pry the back cover off using an iPod opening tool or a similar tool.
- The back cover is attached by several small clips on the inside.

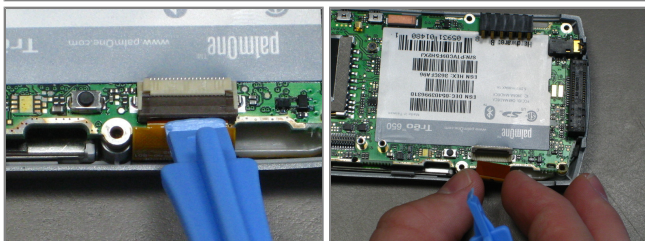

### Step 8 - Motherboard


- Unclip the gray tab.
- Pull out the orange ribbon cable.
- Be careful not to remove the motherboard before disconnecting the ribbon cable so it isn't damaged.






### Step 9


- Pull off the mother board.

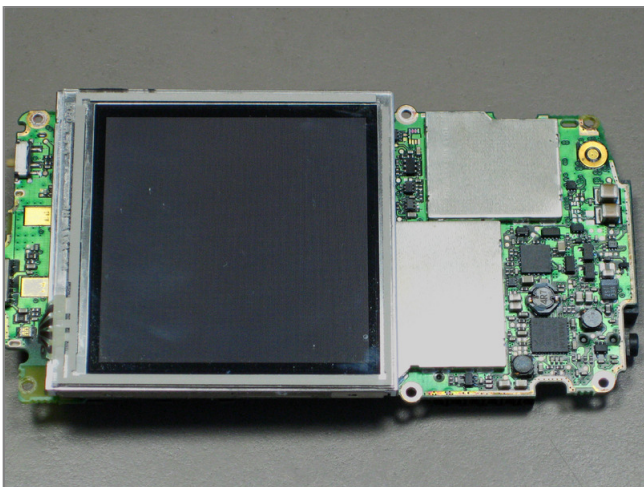

### Step 10 - LCD Screen

- Lift up the LCD screen so that the ribbon strip connecting it to the motherboard can be accessed.
- Be careful not to pull off LCD screen yet.

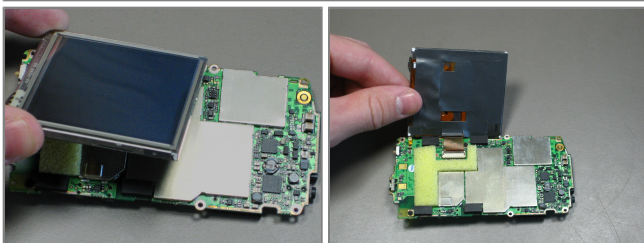

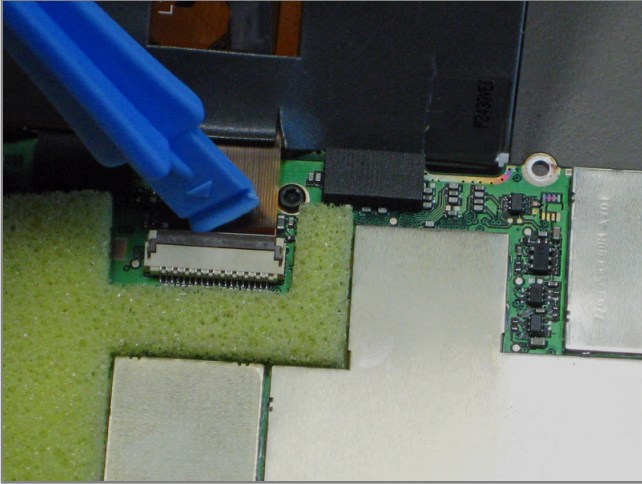

### Step 11

- Unclip the gray tab.
- Pull out the orange ribbon strip.
- Remove the LCD screen.

